

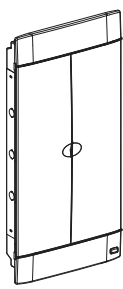


R9HSB●●●S

R9HSB●●●F

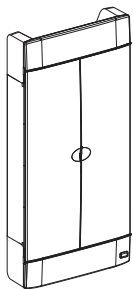

Surface Mount Flush Mount

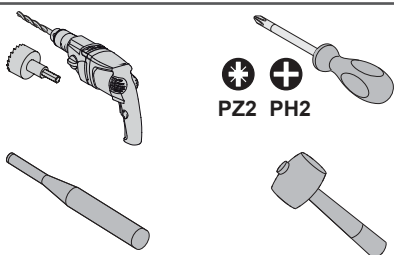

PZ2 PH2

PLEASE NOTE

- This equipment must be installed and maintained by a qualified electrician in accordance with the appropriate statutory regulations and codes of practice.
- All applicable local, regional and national regulations must be complied with during the installation, use, maintenance and replacement of this device.
- This product should not be installed if, when unpacking it, you observe that it is damaged.
- Schneider Electric cannot be held responsible in the event of noncompliance with the instructions in this document and in the documents to which it refers.
- The service instruction must be observed throughout the life time of this product.

⚡ ⚠ DANGER

HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH




- Turn off all power supplying this product before working on it.
- Use a voltage tester with a suitable rated voltage in order to check that all active conductors aren't energized.
- Carefully inspect the work area to check that no tools or objects could have been left inside the equipment.

Failure to follow these instructions will result in death or serious injury.

1 Unboxing

R9HSB●●●S



R9HSB●●●F

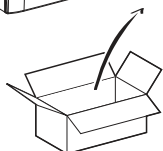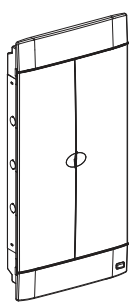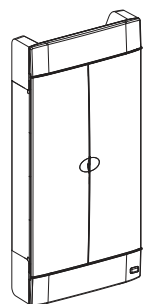

Commercial Reference Number	Instruction Sheet	White Label	Pole Filler	Earth Conductor Tag	Comb Busbar Pin Type	Earth Wire	U-Link	Screw (M4)
R9HSB110F	1	1	1	1	1	-	1	4
R9HSB115F	1	1	1	1	1	1	2	4
R9HSB215F	1	1	2	1	2	1	2	4
R9HSB315F	1	1	2	1	3	2	2	4
R9HSB415F	1	1	3	1	4	3	3	4
R9HSB115S	1	1	1	1	1	1	2	4
R9HSB215S	1	1	2	1	2	1	2	4
R9HSB315S	1	1	2	1	3	2	2	4
R9HSB415S	1	1	3	1	4	3	3	4

2 Removal of Front Cover




R9HSB●●●S, R9HSB●●●F

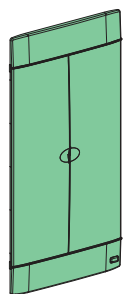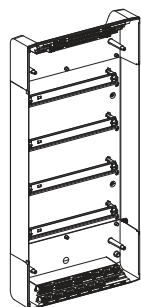

Cable Entry Knockouts

R9HSB●●●S

R9HSB●●●F

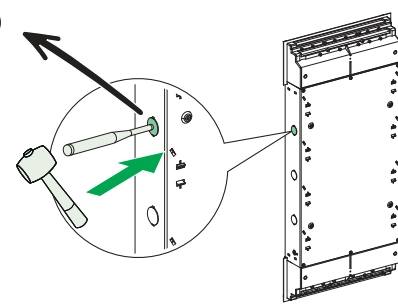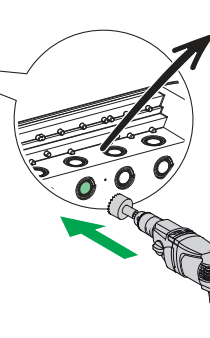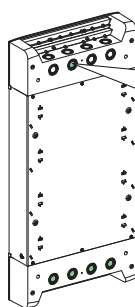

Note:


- Remove minimum number of knockouts required for the incoming and outgoing cables to pass through easily.
- IP rating shall be maintained, suitable cable protection shall be applied with appropriate conduit.

Surface Mount:




	A (mm)	B (mm)
R9HSB115S	260	115
R9HSB215S	338	309
R9HSB315S	338	559
R9HSB415S	338	693

Note: Mark the points corresponding to the box keyholes and drill holes accordingly.

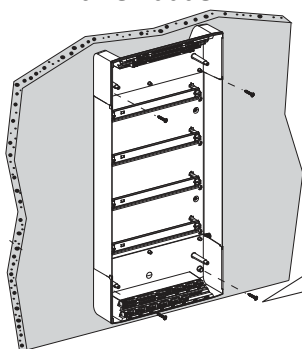

Screw M5 x4

0.8 N.m

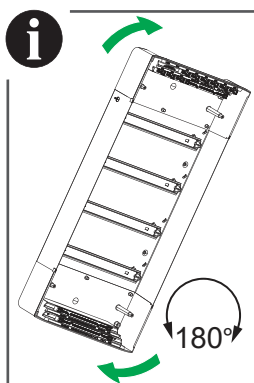


Note: Reverse the enclosure based on cable entry (top or bottom).

C (mm)	D (mm)	E (mm)
246	223	70
335	223	70
335	357	70
335	631	70
335	765	70

Note:

- Fix the box in the wall cavity with the outer edges projecting out the wall's surface (marking provided).
- Option of metal back plate available - Refer catalog for more details.

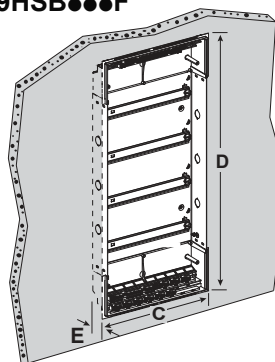


70 mm

Wall

Note: Refer the instruction sheet of devices for more information.


5.1 Assembly of Front Cover

R9HSB●●●S, R9HSB●●●F

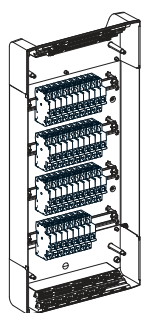

Screw M4 x4

0.8 N.m

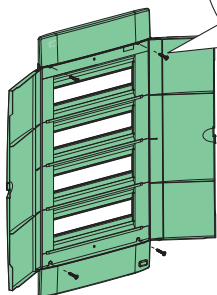


NOTICE

EQUIPMENT DAMAGE

Do not open the enclosure door beyond the stopper.
Failure to follow this instruction will result in the equipment damage.

5.2 Labelling and Assembly of Pole Filler

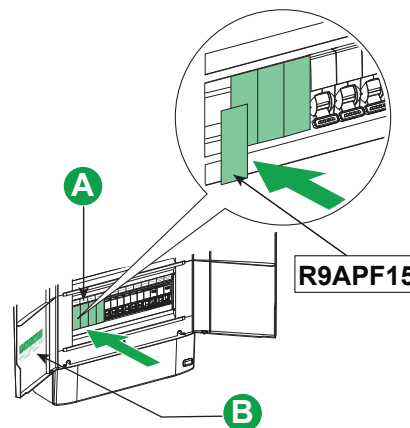[illegible]

R9APF15